


HALLWAY TILE DETAIL

6" ± 1'-0"

42D-A151-800-DETL

10.14.11

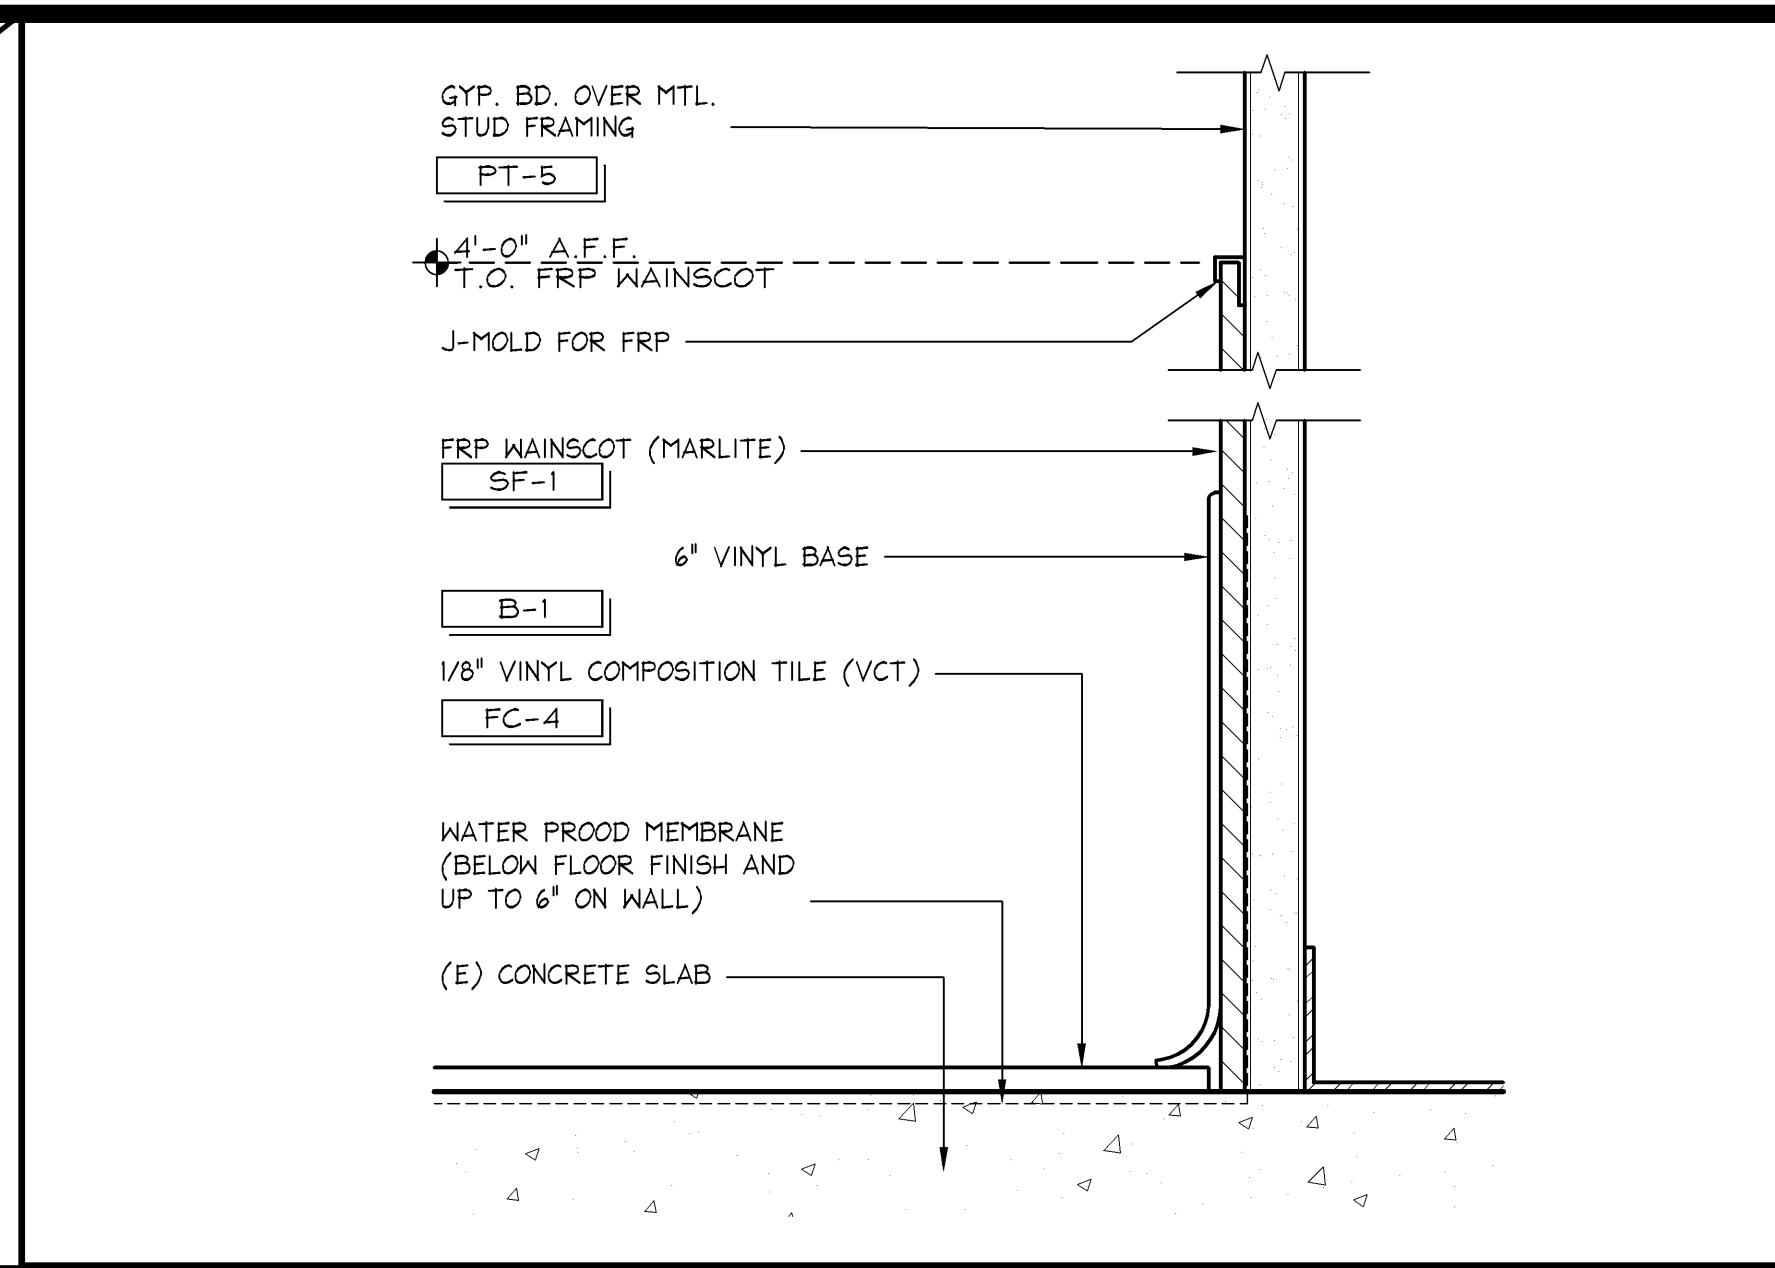


VCT FLOOR W/ VINYL BASE

6" ± 1'-0"

42D-A121-M00-DETL

09.08.09

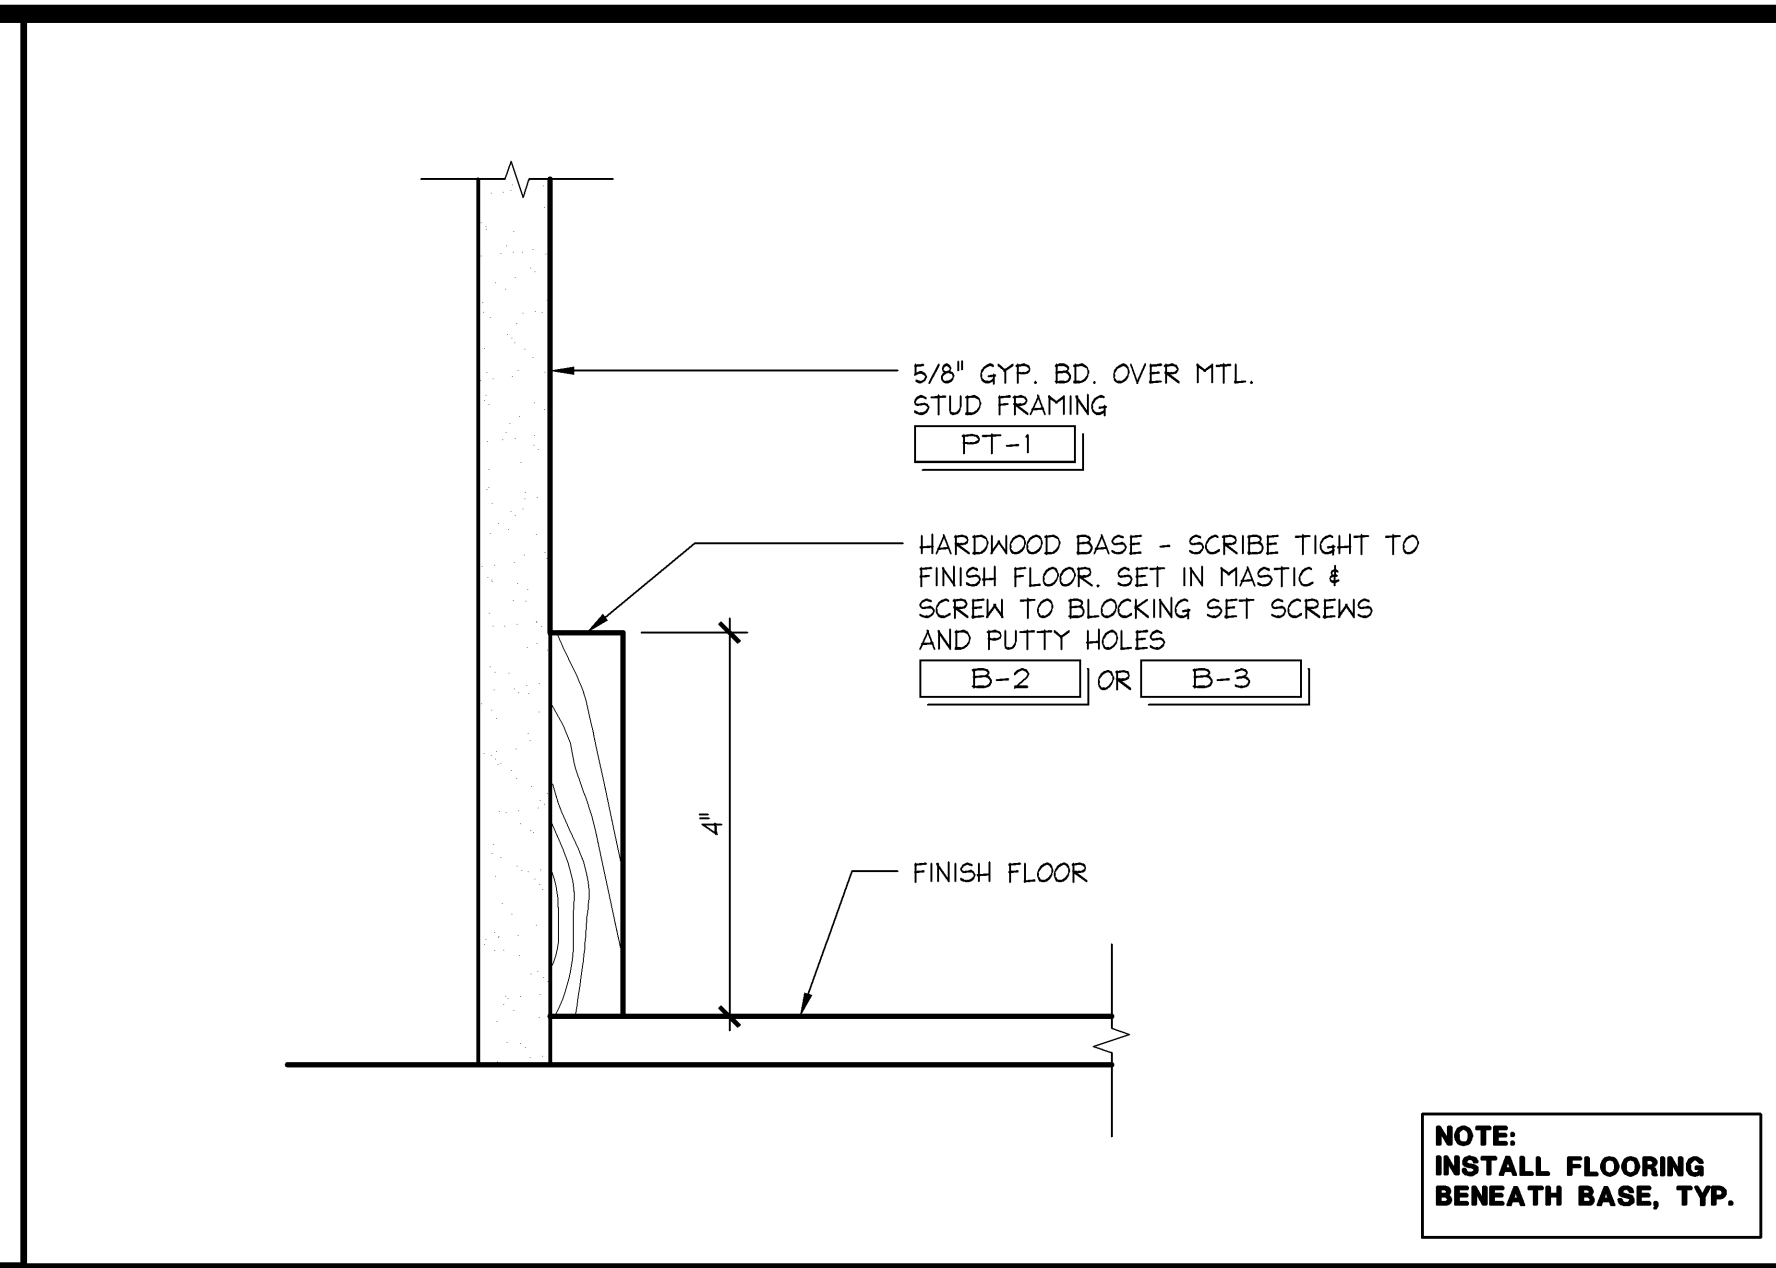


BASE DETAIL

6" ± 1'-0"

42D-A121-H00-DETL

04.21.10

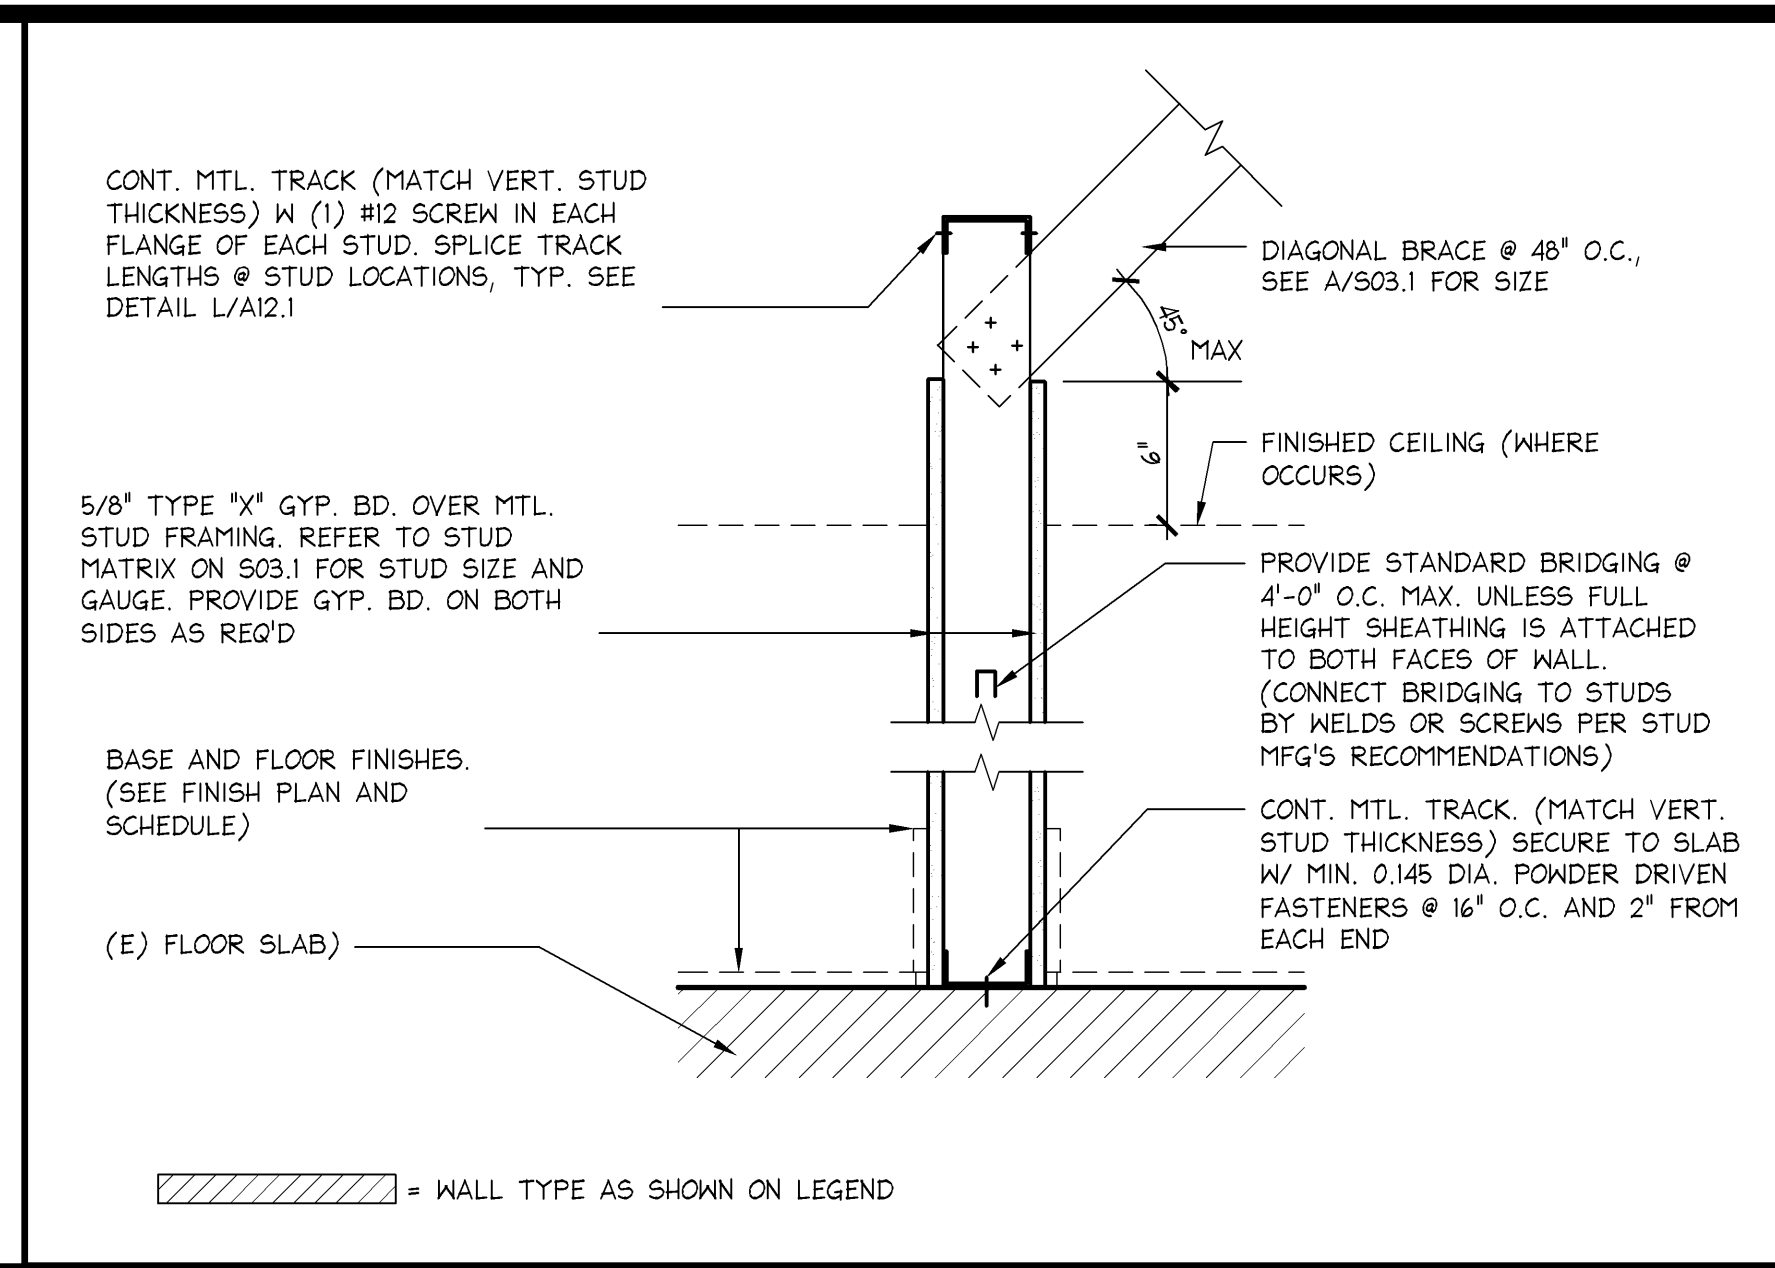


NON-RATED PARTITION

1 1/2" ± 1'-0"


42S-A121-D00-SECT

07.27.09

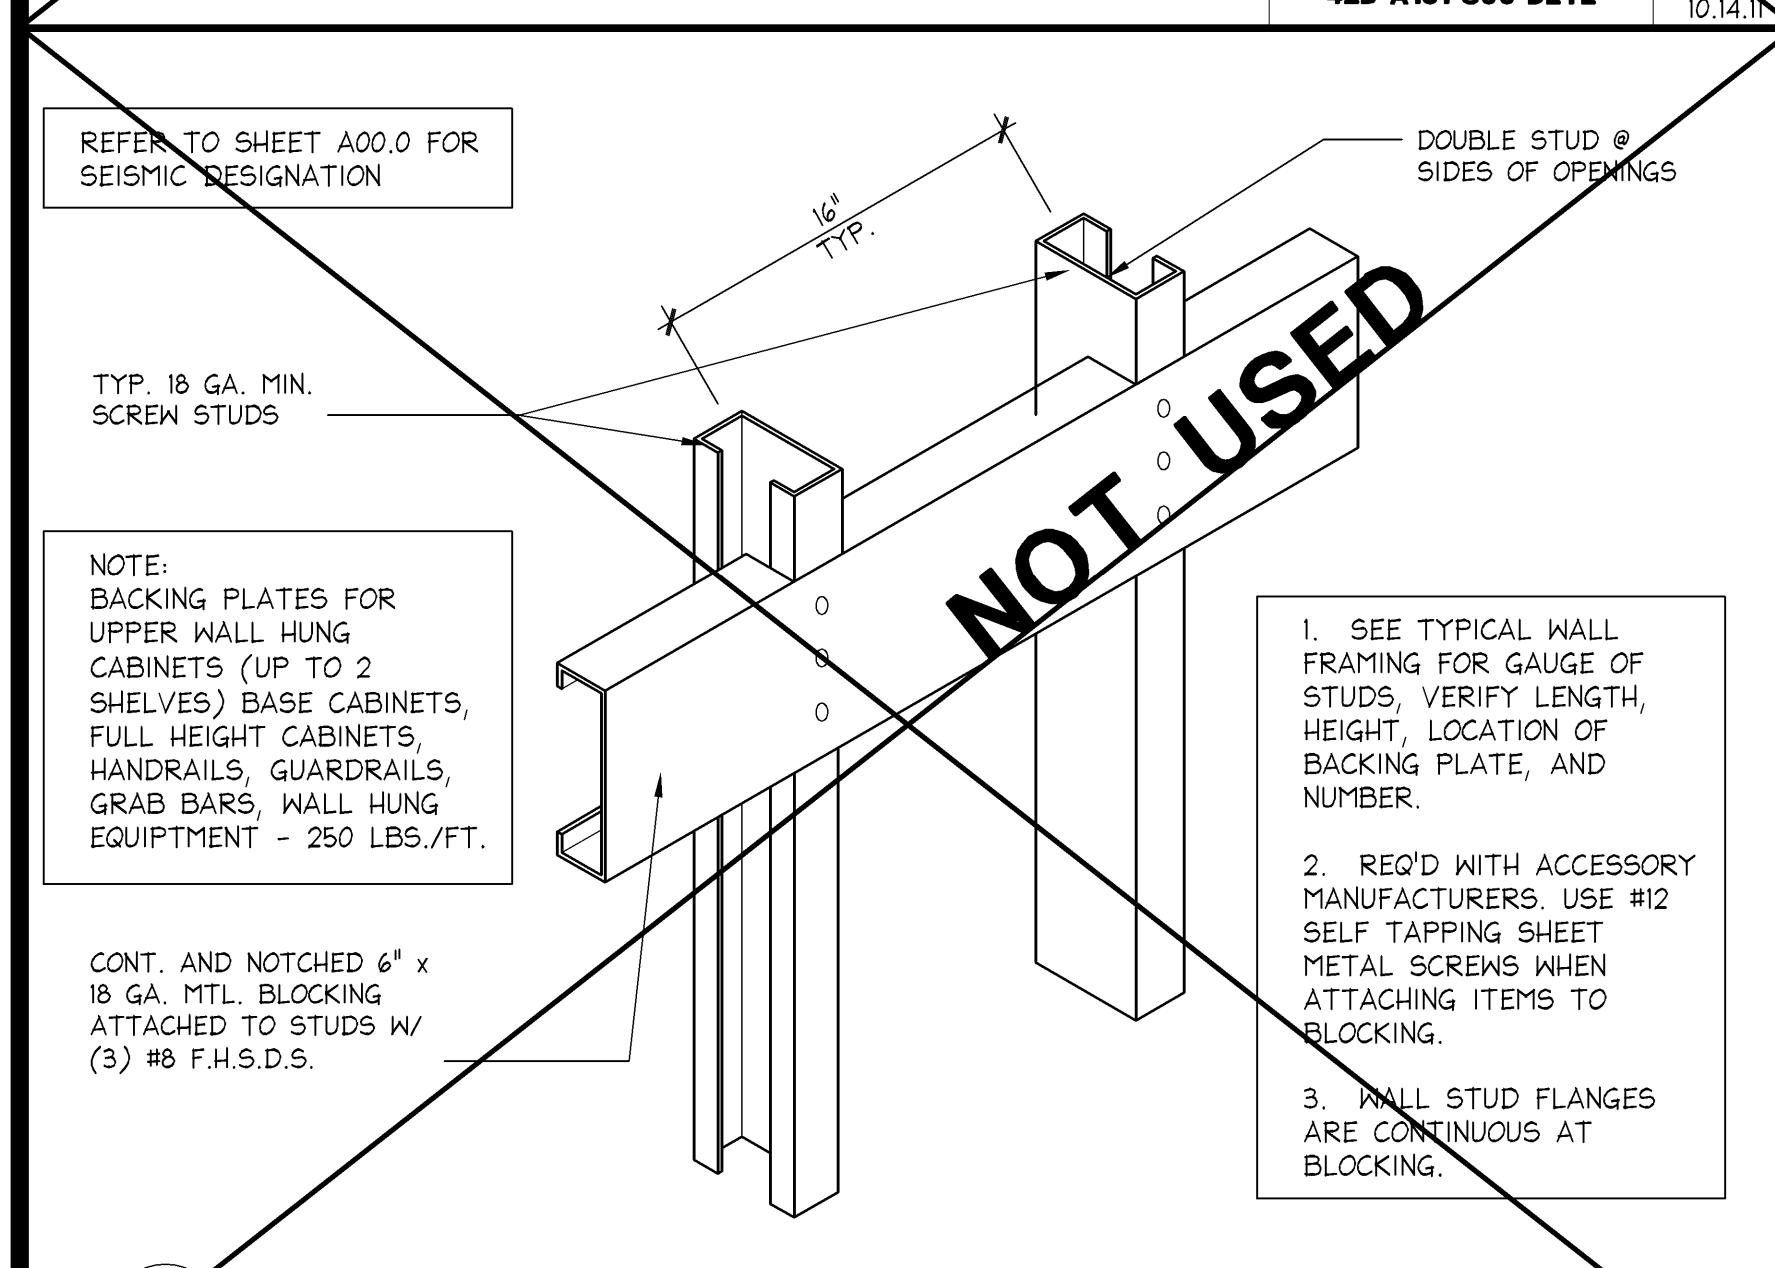

HIGH SEISMIC

SEISMIC CATEGORY: D, E, F

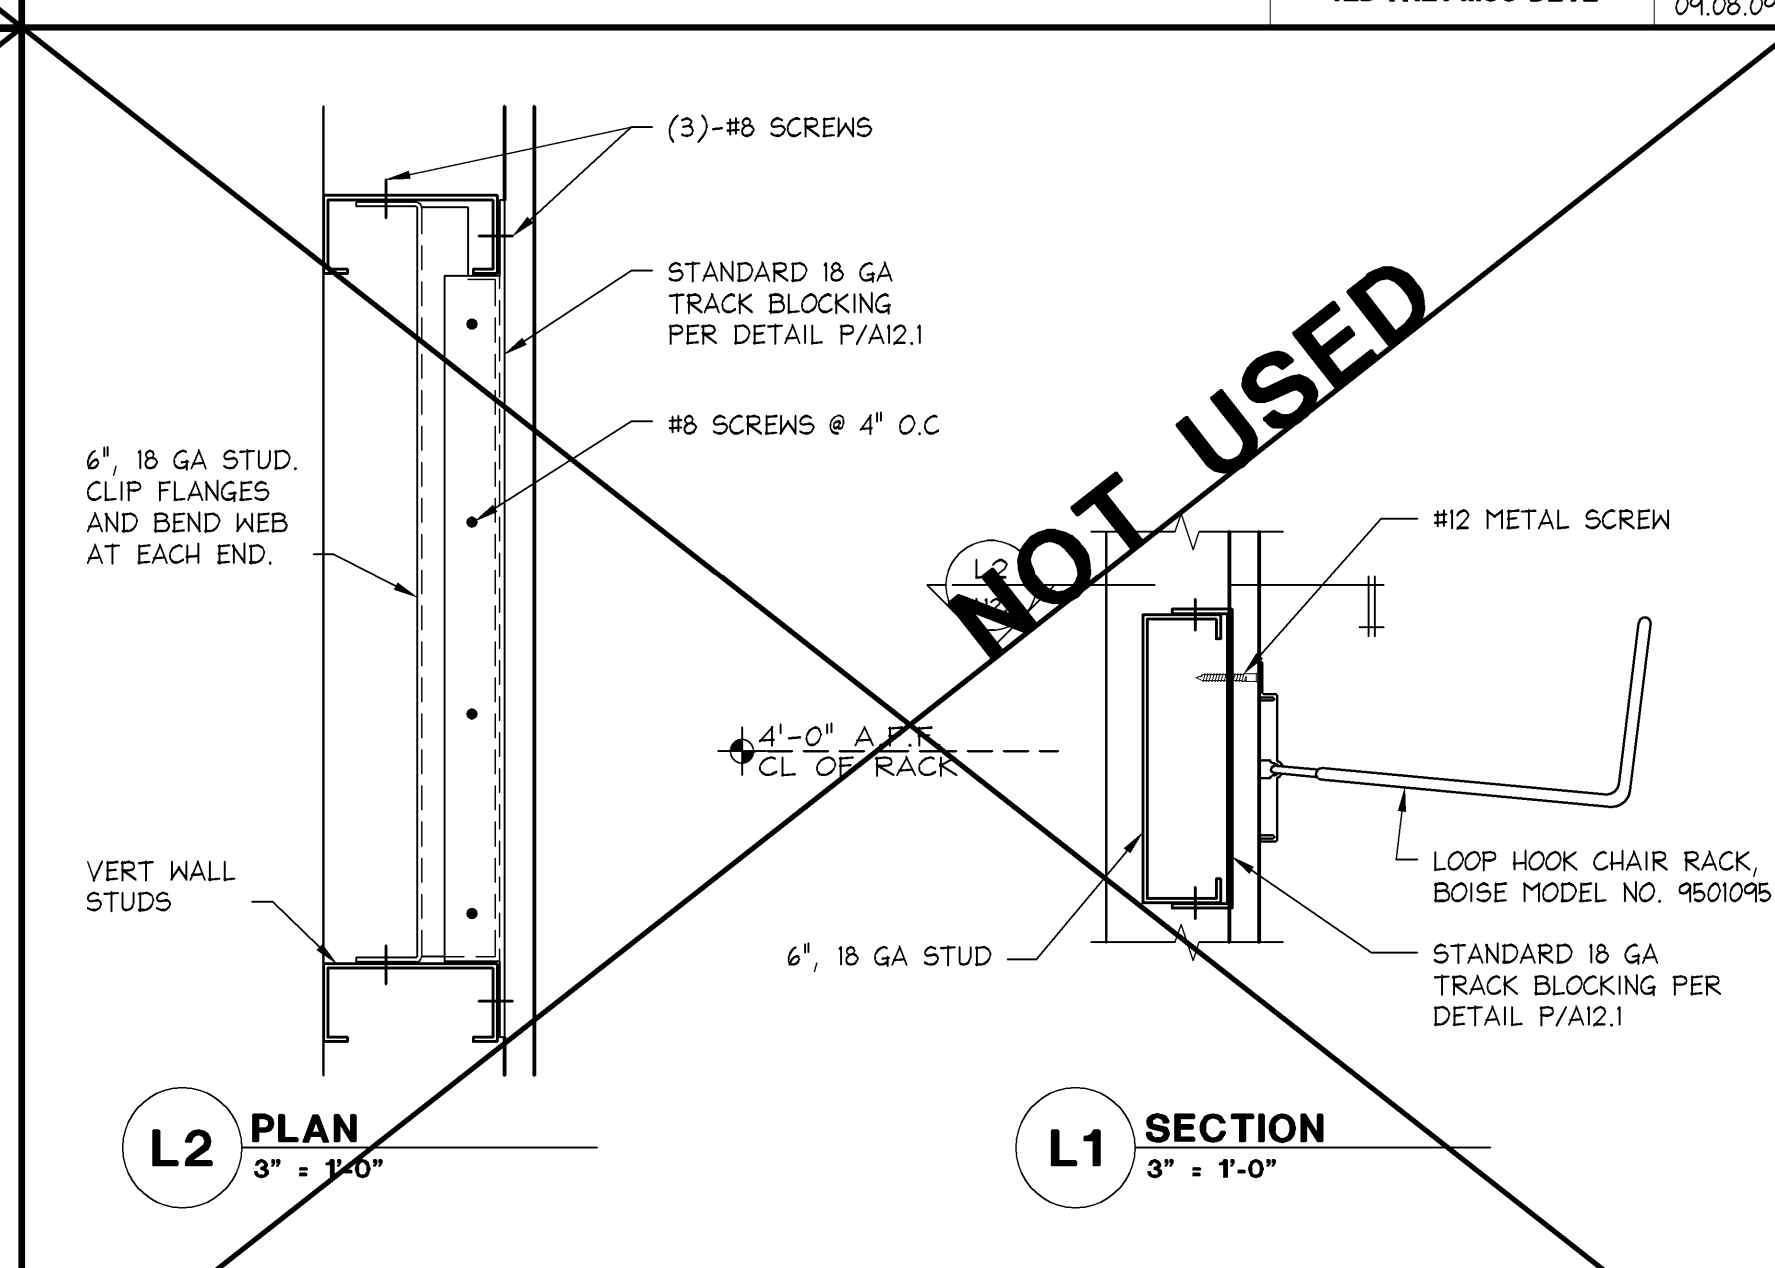


CHAIR RACK DETAIL

3" ± 1'-0"

42D-A121-L00-DETL

03.16.12

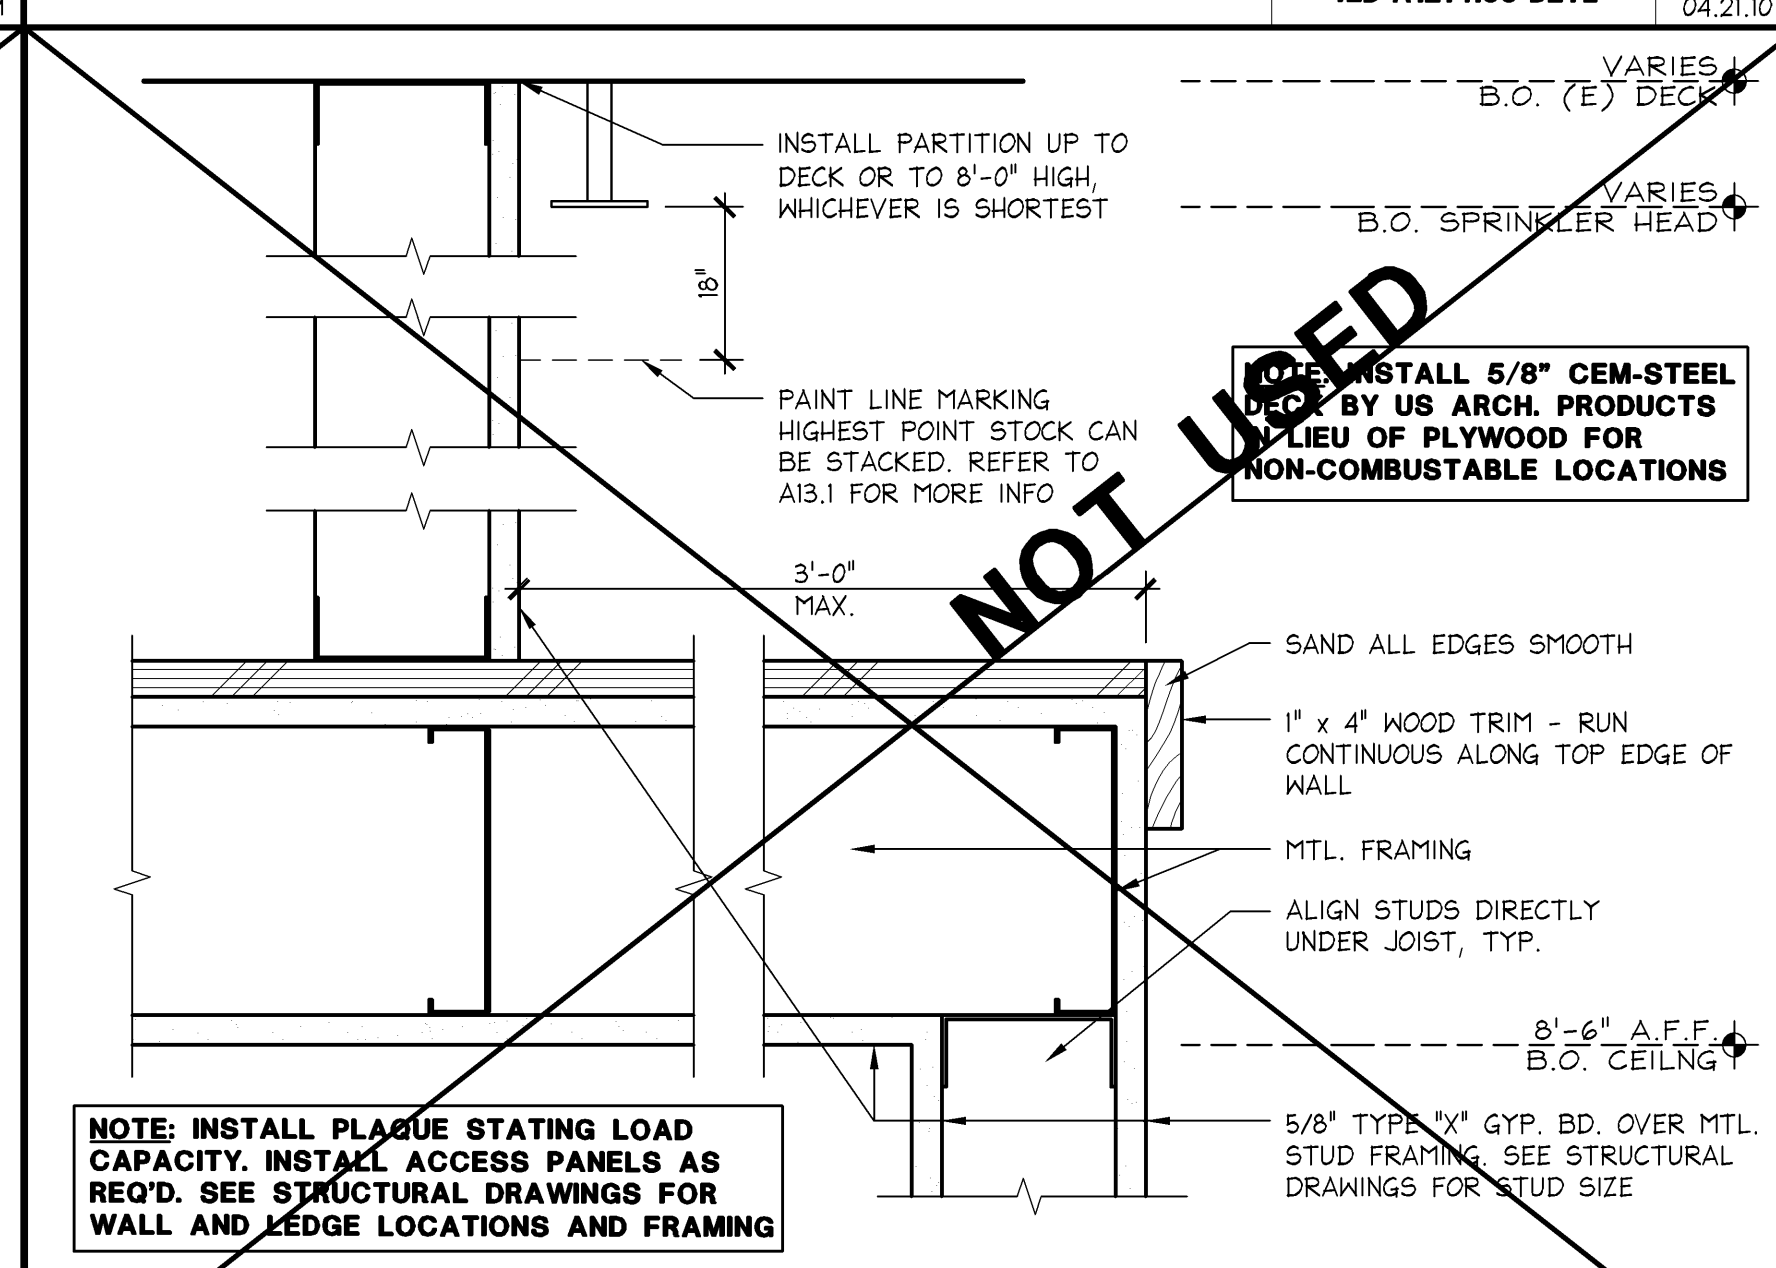


SECTION @ LEDGE (TOILET)

3" ± 1'-0"

42S-A121-G00-SECT

07.30.09

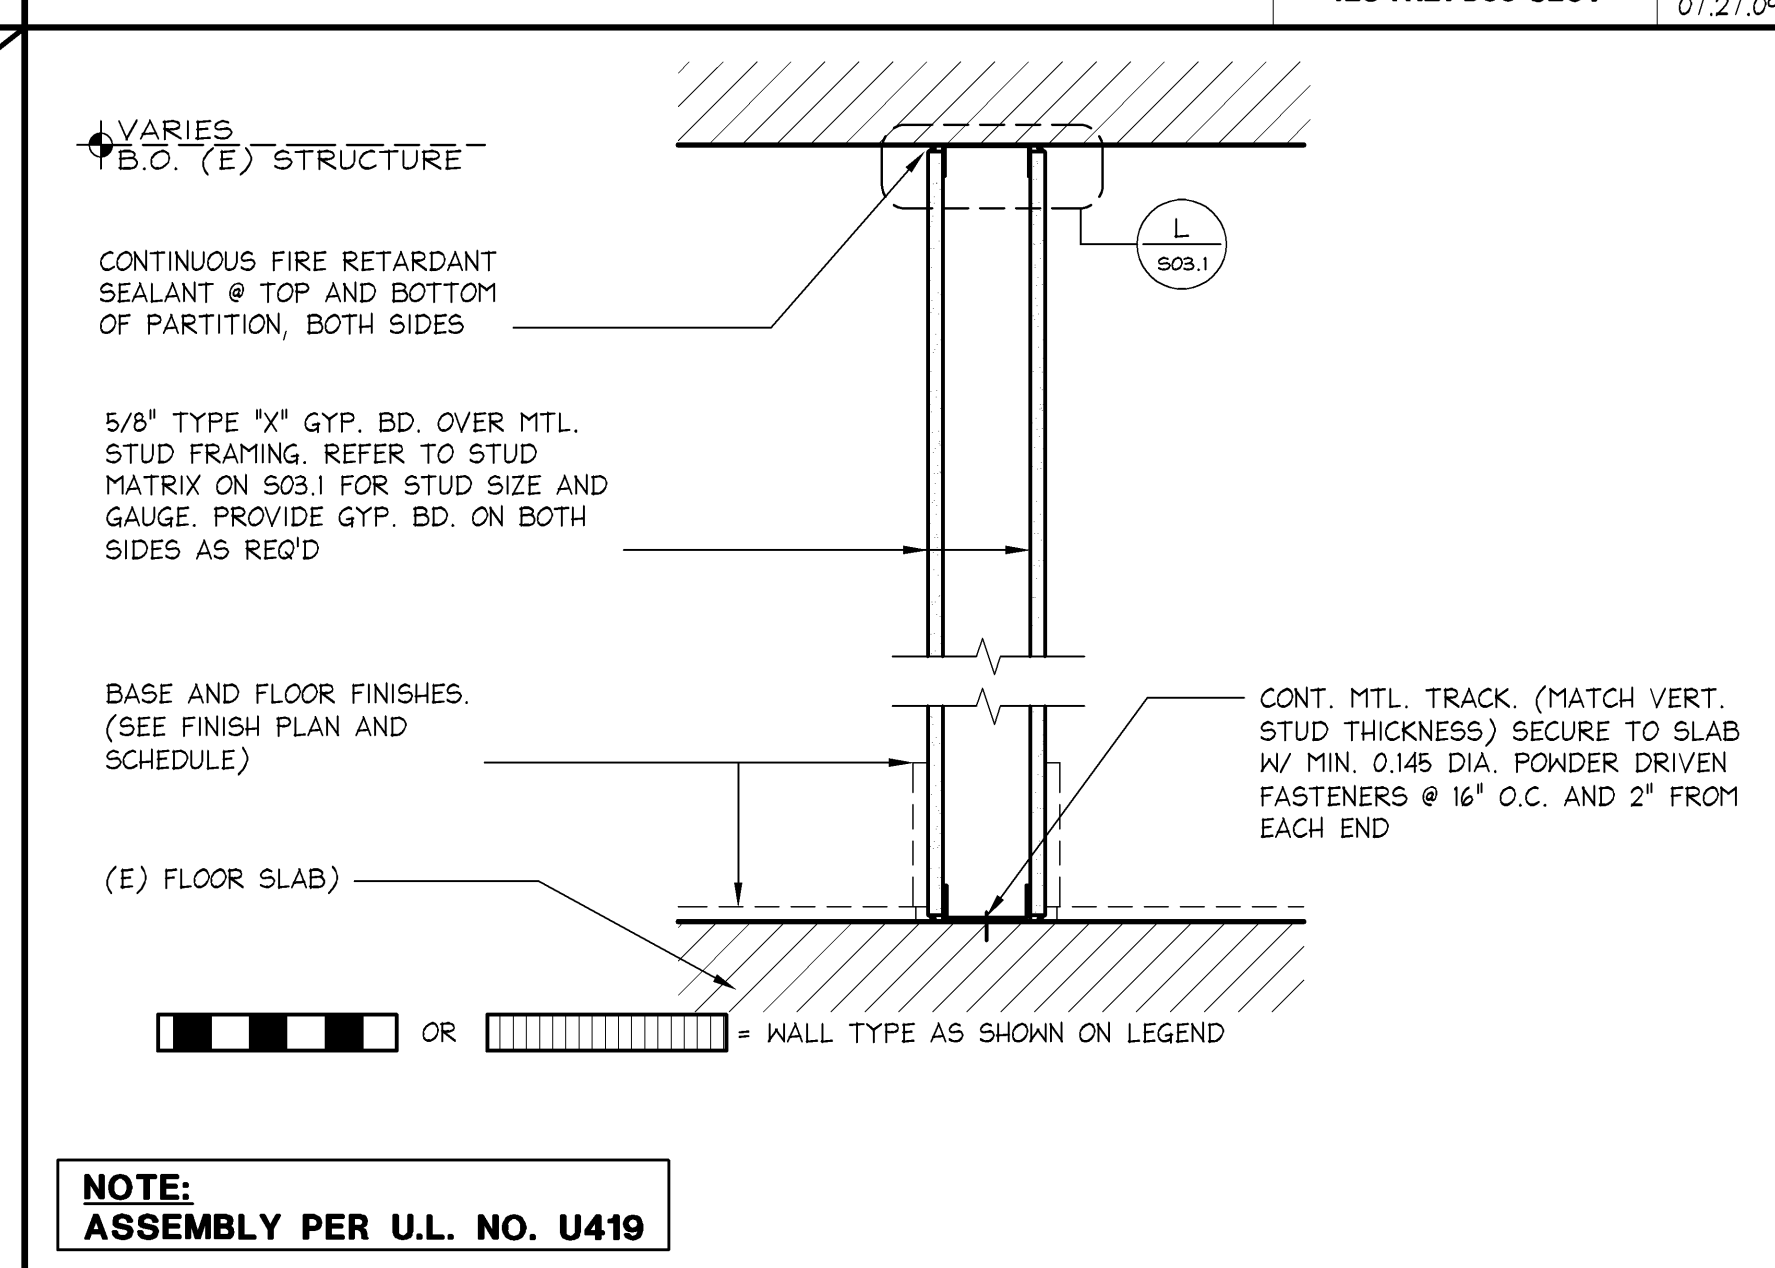


1-HOUR RATED PARTITION

1 1/2" ± 1'-0"


42S-A121-C00-SECT

04.27.10

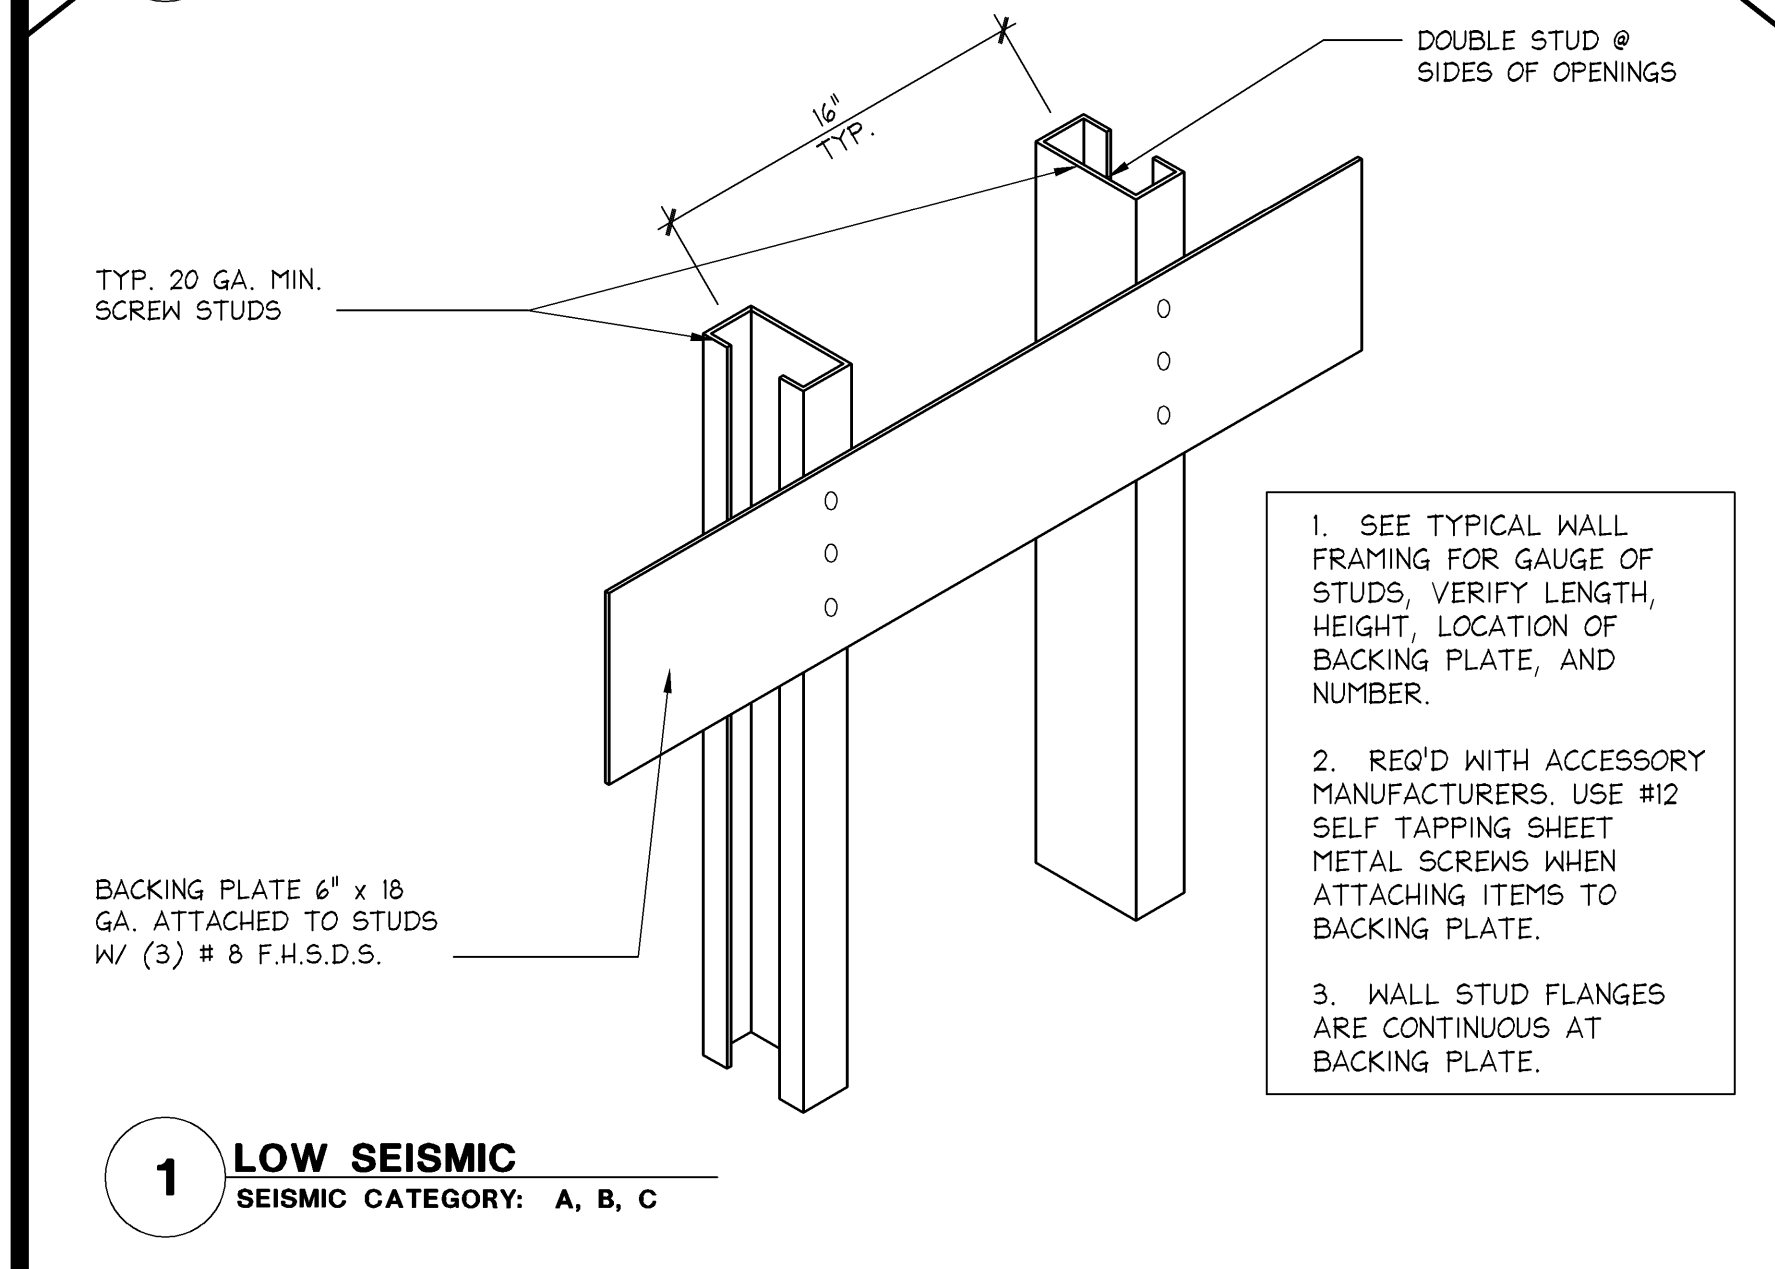

LOW SEISMIC

SEISMIC CATEGORY: A, B, C

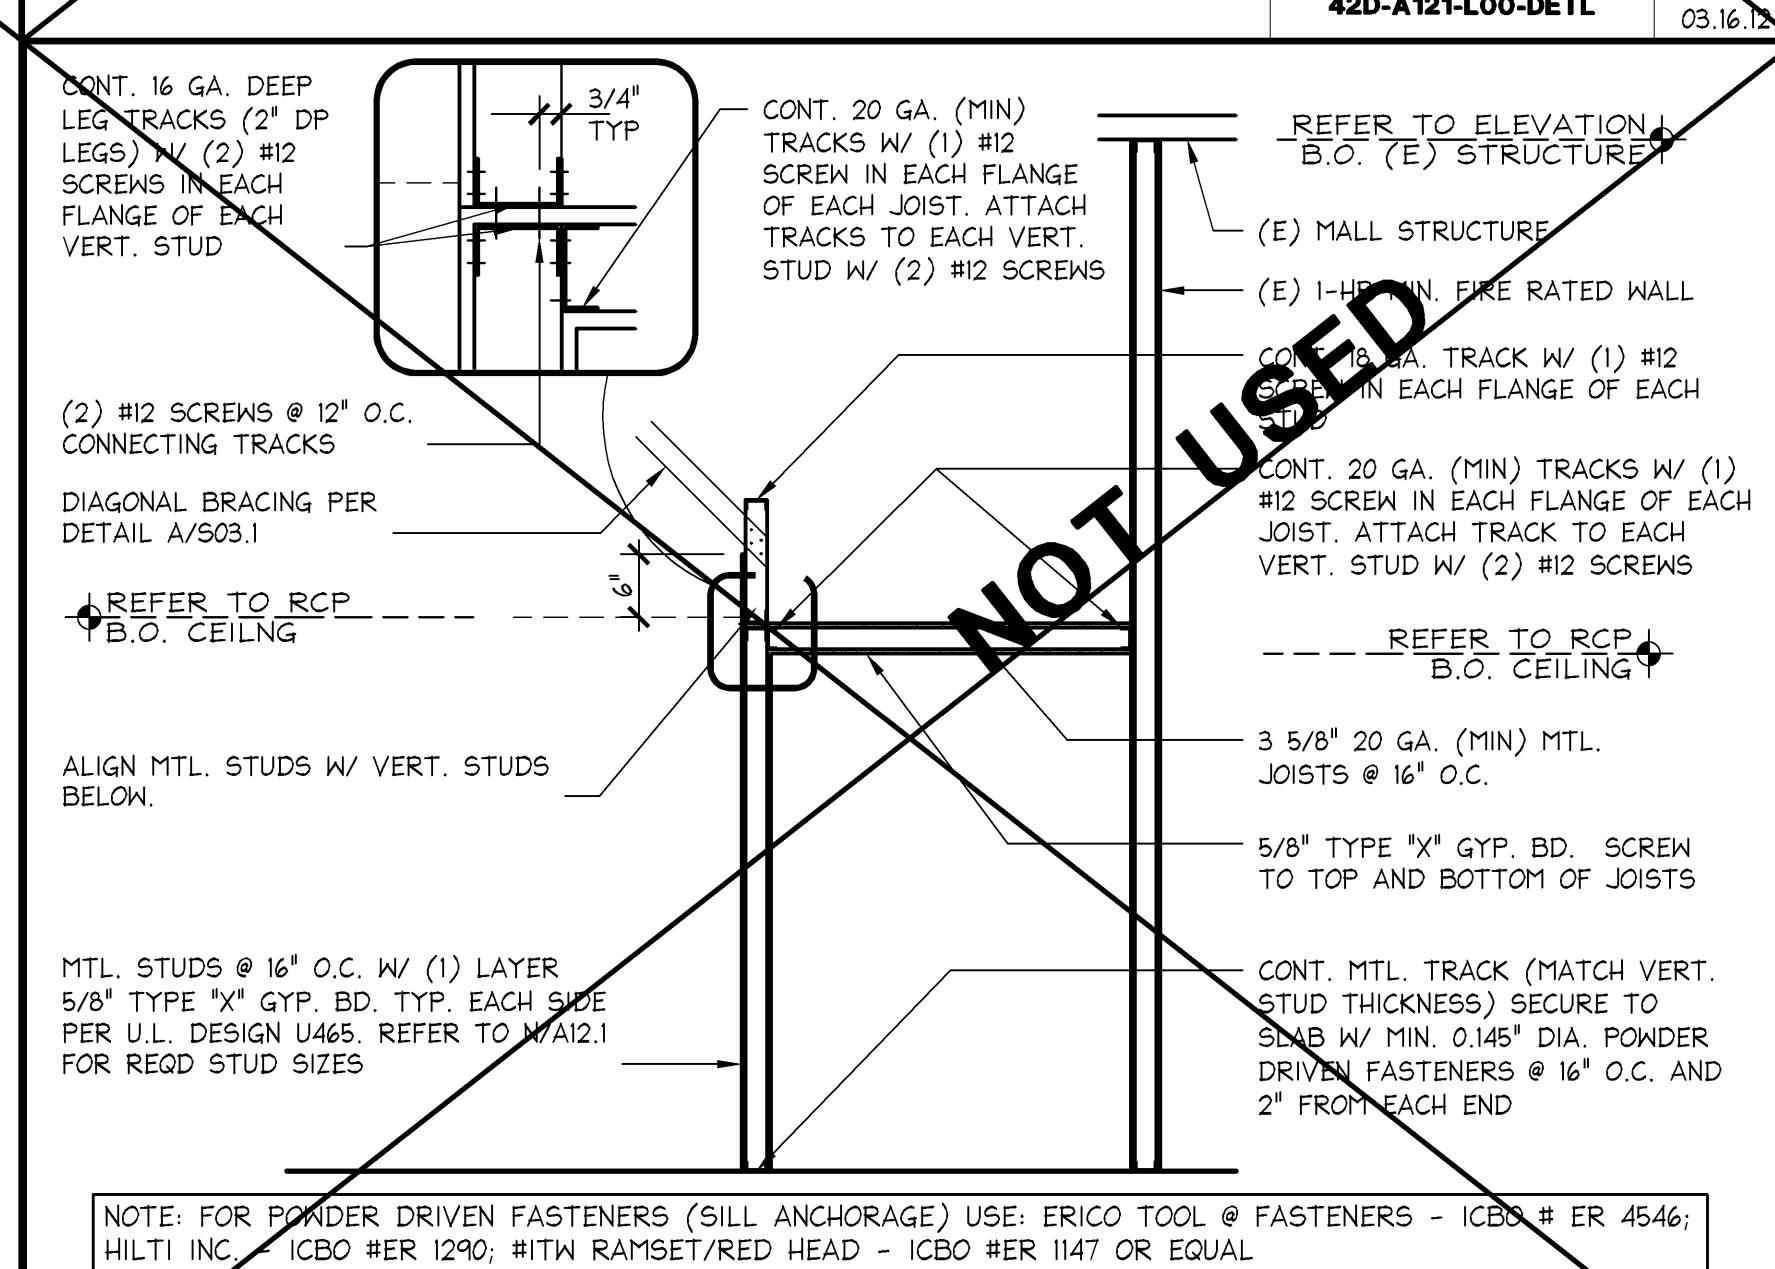


SECTION THRU CORRIDOR PARTITION

FULL

42S-A121-K00-SECT

07.30.09

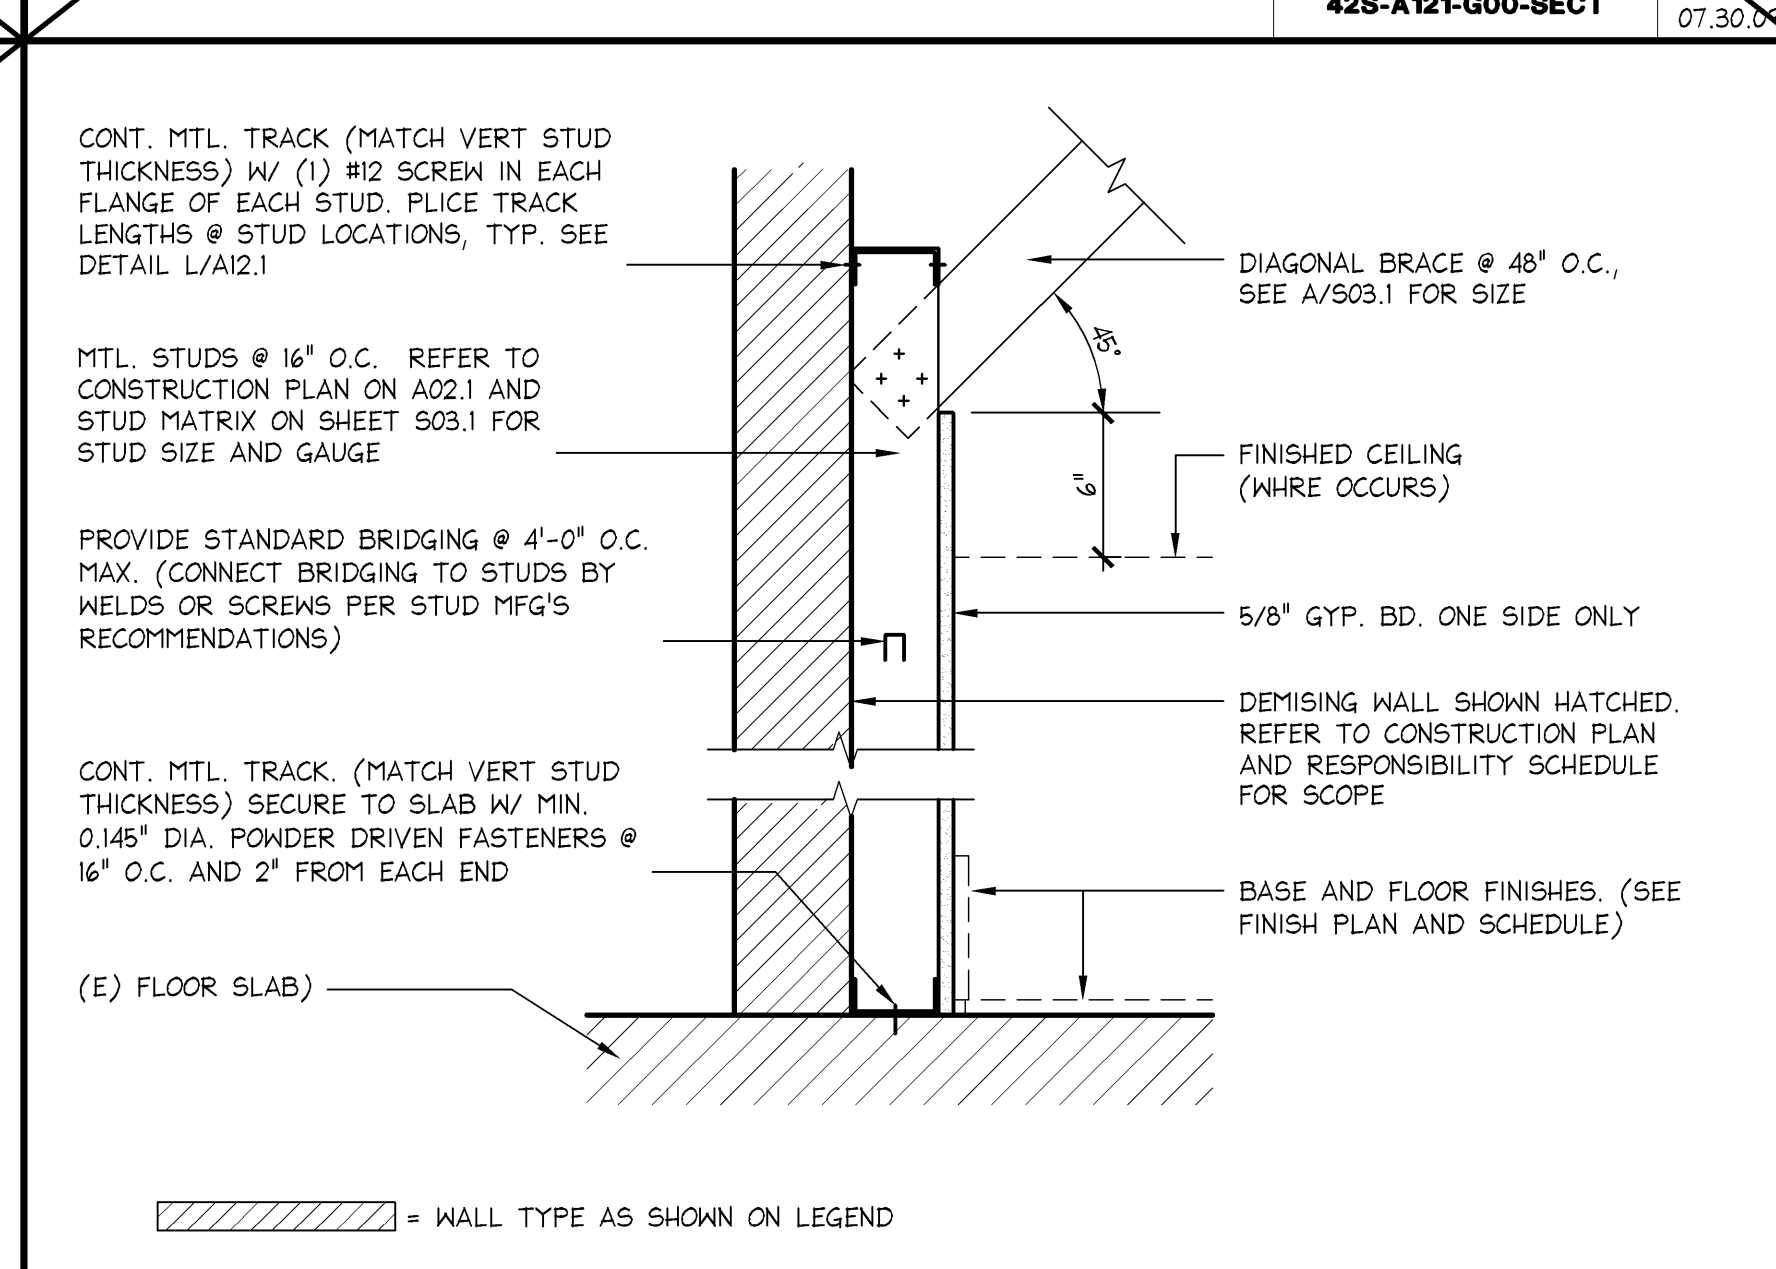


FURRED PARTITION

1 1/2" ± 1'-0"

42S-A121-F00-SECT

07.30.09

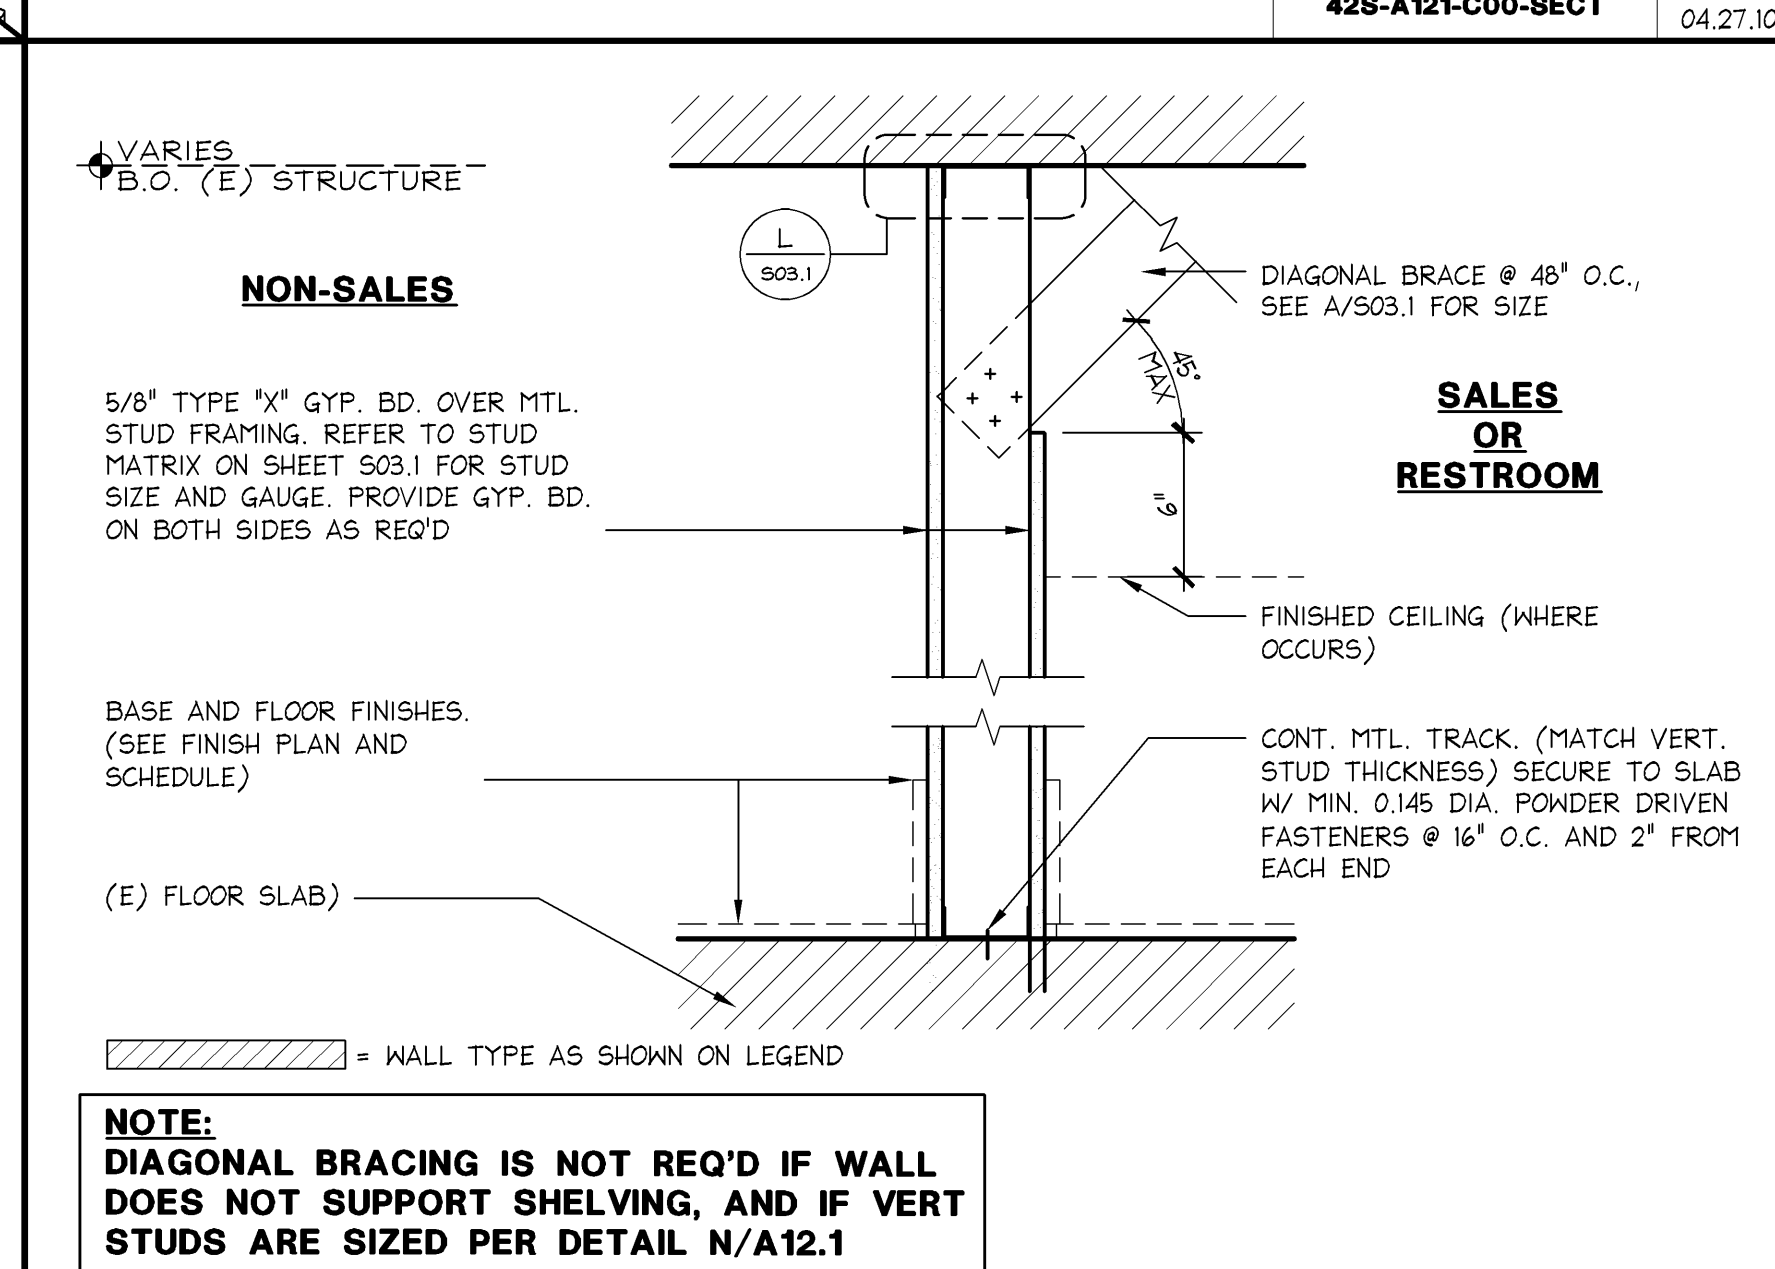


NON-RATED PARTITION (TO STRUCTURE)

1 1/2" ± 1'-0"

42S-A121-B00-SECT

04.27.10

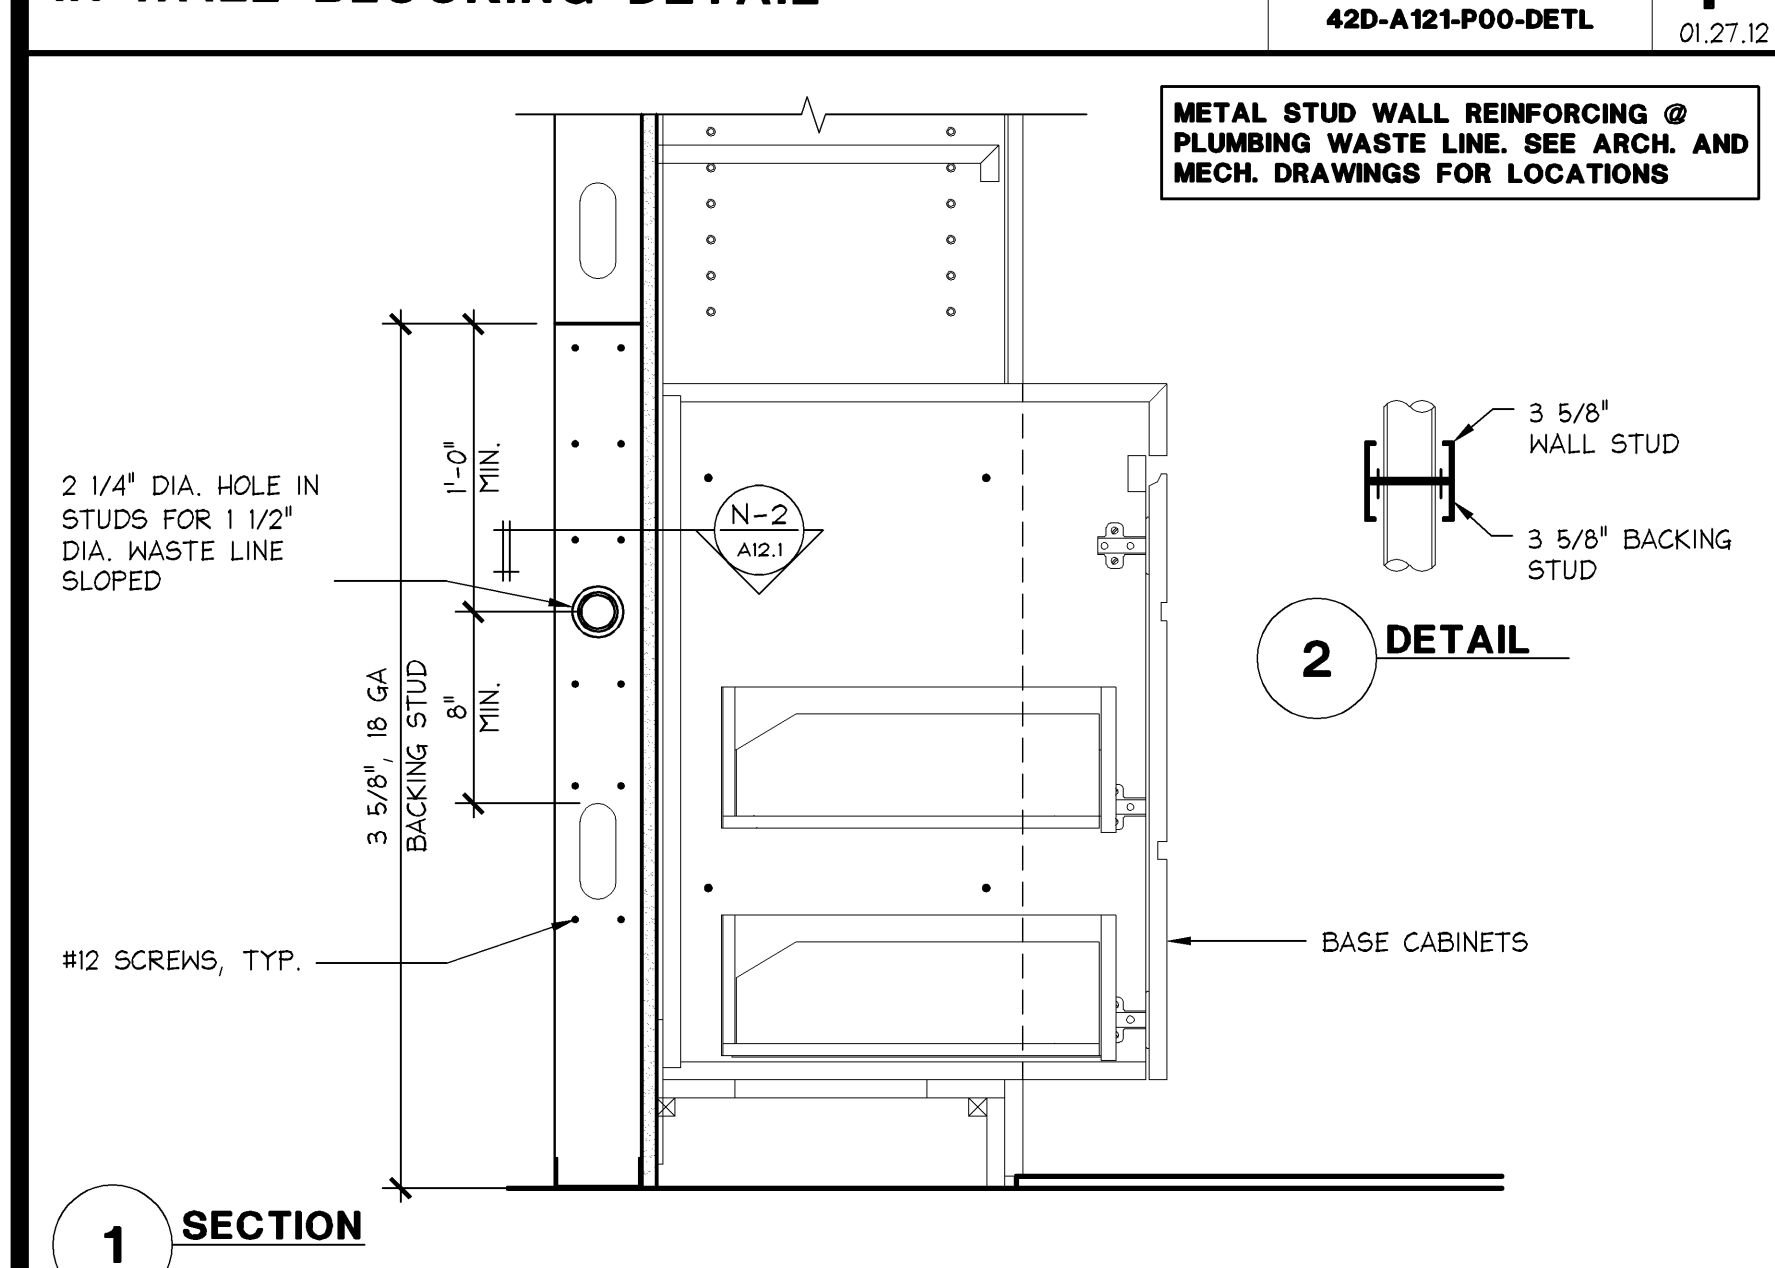


PLUMBING STUD @ "UNIT 1"

1 1/2" ± 1'-0"

42D-A121-P00-DETL

01.27.12

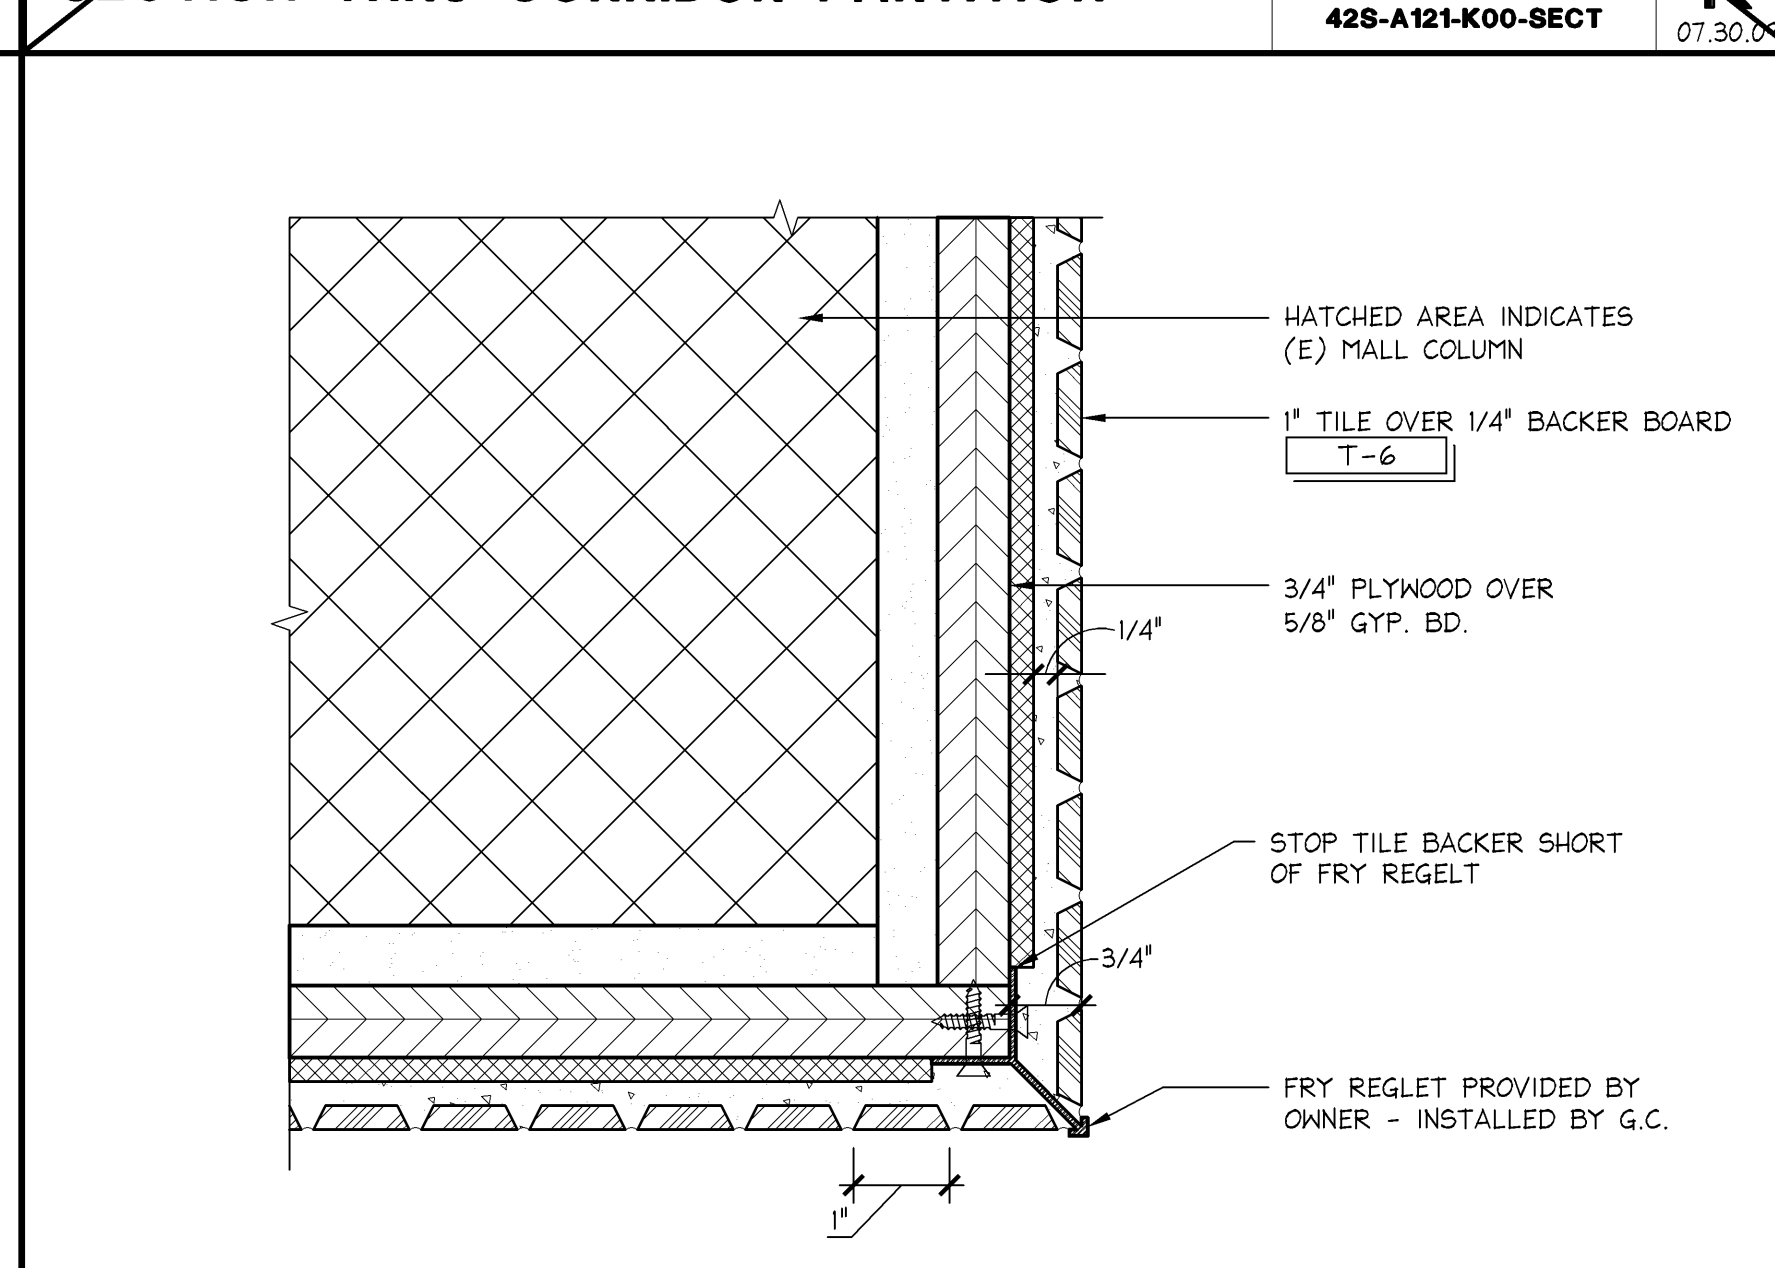


TILED COLUMN DETAIL

6" ± 1'-0"

42D-A121-J02-DETL

10.14.11

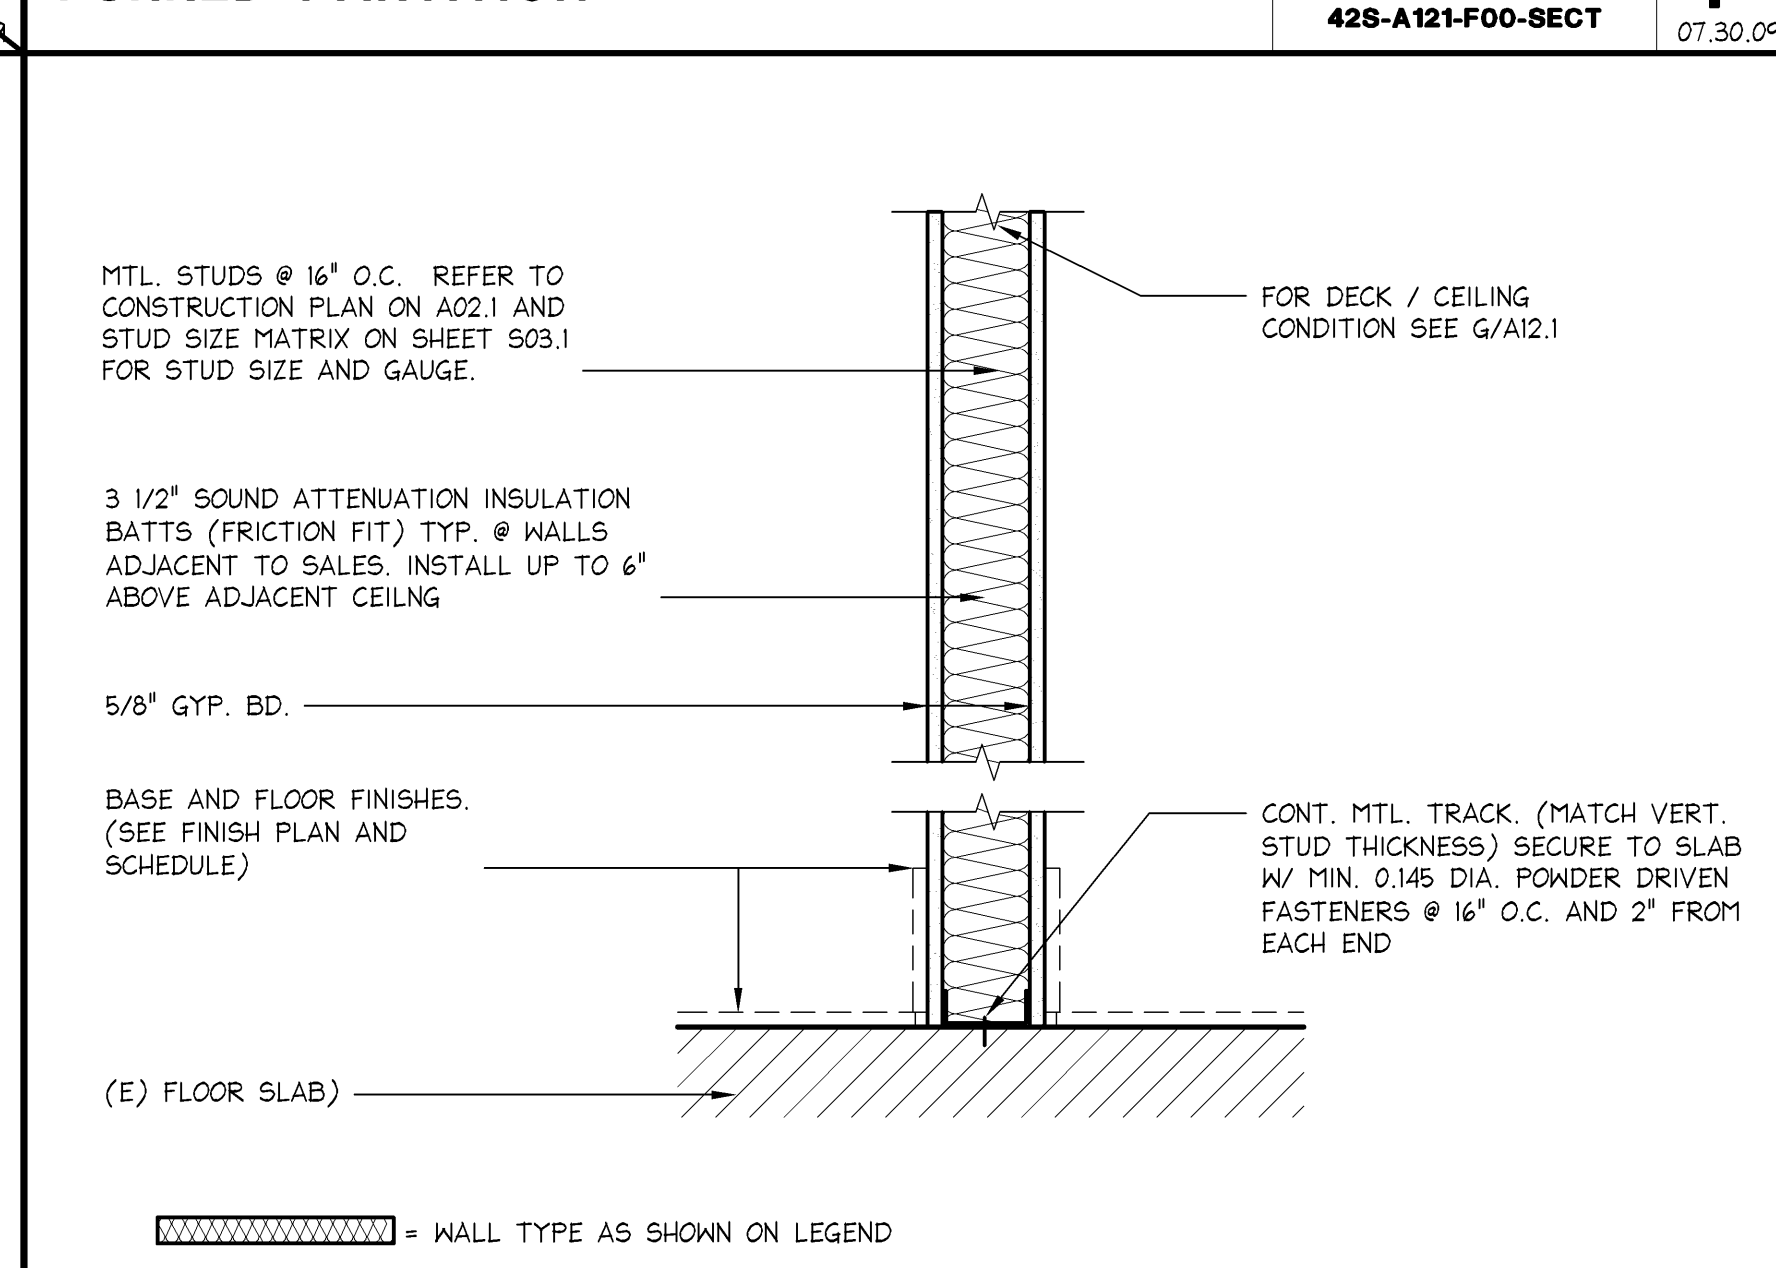


TOILET PARTITION

1 1/2" ± 1'-0"

42S-A121-E00-SECT

07.30.09

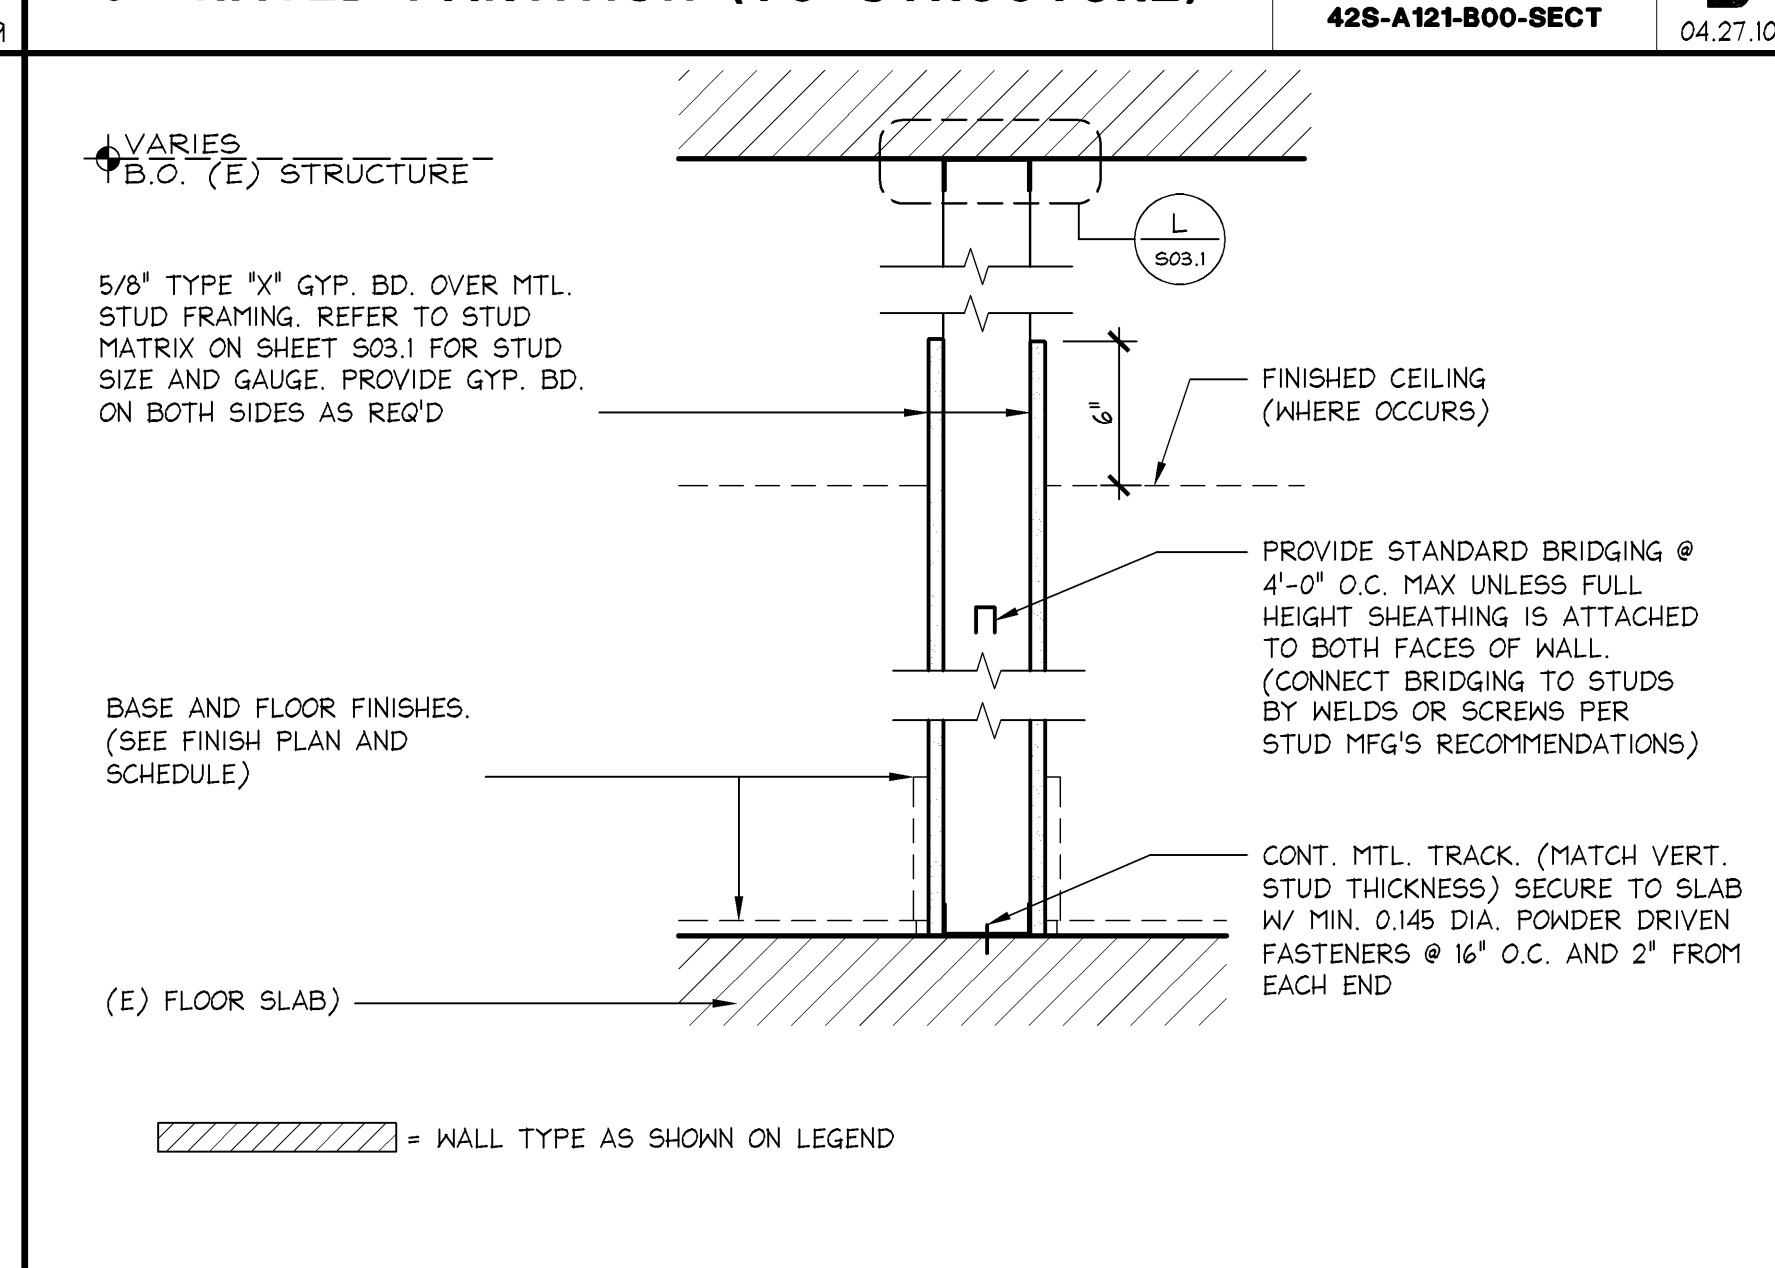

NON-RATED PARTITION

1 1/2" ± 1'-0"

42S-A121-A00-SECT

04.27.10